

## STREAM BANK STABILITY ASSESSMENT IN GRAZED RIPARIAN AREAS

Mark S. Riedel, PhD, Baird & Associates, Madison, WI, [mriedel@baird.com](mailto:mriedel@baird.com); Kenneth N. Brooks, PhD, U. of MN, Forest Resources, St. Paul, MN, [kbrooks@umn.edu](mailto:kbrooks@umn.edu); Elon S. Verry, PhD, Ellen River Partners, Grand Rapids, MN, [sverry@mchsi.com](mailto:sverry@mchsi.com)

**Abstract:** Streams in the Nemadji River Watershed of east-central Minnesota are deeply incised in lacustrine clay and glacial till. This region is naturally erosive because of recent glacial activity (~10,000 years ago). Indeed, the Nemadji River is the largest source of fluvial sediments to Lake Superior. While natural land cover was predominantly coniferous forest, riparian areas were commonly converted to pasture by the late 1800's. We investigated stream bank stability under a variety of riparian cattle traffic scenarios to determine the impacts of cattle traffic on stream bank stability over a 3-year period. Grazing significantly reduced stream bank stability. In response, grazed streams adopted “stable” stream bank geometry. While root tensile strength of riparian species dominated resisting forces, the cohesive strength of the lacustrine clay channels was generally sufficient to maintain stable channel geometry in ungrazed streams. The “Pfankuch” method of rating stream bank stability in the field was very consistent with mechanistic estimates and measured values of stream bank stability.

### INTRODUCTION

Streams in the Nemadji River Watershed of east central Minnesota and northwestern Wisconsin cut into glacially derived cohesive, lacustrine clay and clay till (Figure 1). This is important

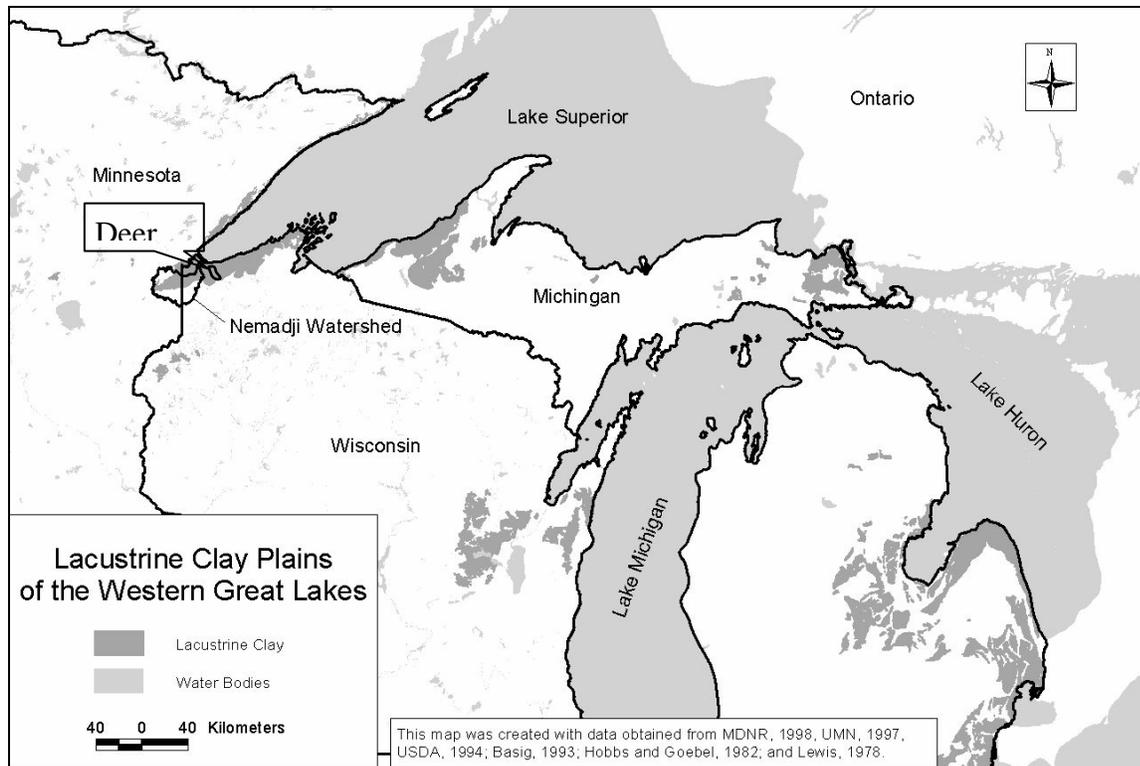


Figure 1 Location of Nemadji Watershed and Lacustrine Clay deposits.

because clay increases the strength and stability of streams (Schumm, 1960). Smith (1998) and Grissinger, et al (1981) found channels in flumes shifted to stable meandering forms when cohesive clays were present. Grissinger, et al observed erosion decreased 50% as clay content increased by 33%. Similarly, Dunaway, et al, (1994) reported bank erosion rates decreased as clay to silt ratios increased and noted root density limited bank erosion. Riparian land use conversion often reduces the stability of “natural” gravel and sand bed streams (Abernethy and Rutherford, 2000; Millar, 2000; Hupp, 1999; Hupp, 1992; and Charlton, et al., 1978) and causes morphologic response (Osman and Thorne, 1998 and Huang and Nanson, 1998). In-situ influences of streamside land use on stability and morphology in cohesive clay channel streams is largely undocumented. We observed morphology and stability on a cohesive clay channel stream experiencing cattle disturbance over three consecutive summers.

**Site Description:** Three study reaches were installed on Deer Creek (Figure 2). The upstream Reach I (50 m long, 4 cross sections, 3.47 km<sup>2</sup> watershed), separated a barn and adjacent 16 ha pasture. The stream experienced frequent traffic (many times/day) from 40 beef cattle and 25 sheep. Most native cover was gone and streambanks were 20% vegetated with perennial grasses and herbs. Flood plain vegetation consisted of herbaceous plants and perennial grasses, and a 30 % deciduous tree canopy dominated by quaking aspen (*Populus tremuloides*), black ash (*Fraxinus nigra*) and paper birch (*Betula papyrifera*) with diameters ranging from 20 – 50 cm at breast height (dbh).

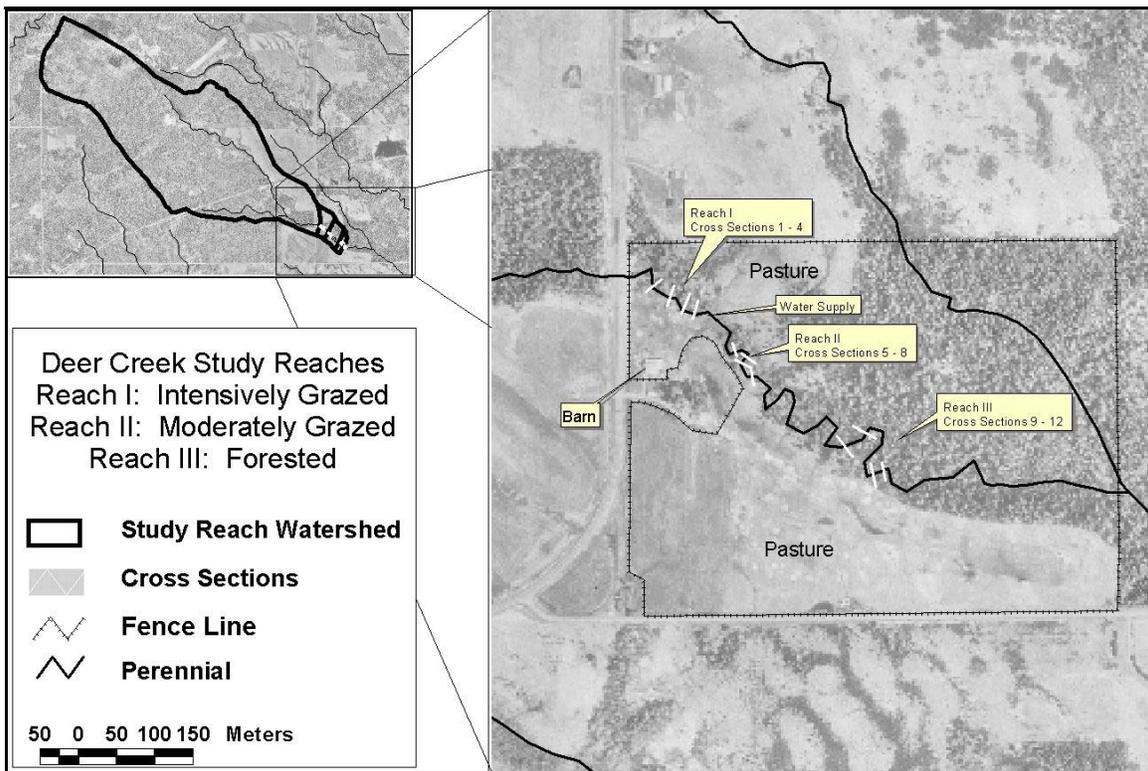


Figure 2 Location of Deer Creek study reaches.

Downstream, Reach II (75 m long, 4 cross sections, 3.52 km<sup>2</sup> watershed) flowed through a forested pasture. Native vegetation was largely absent, cattle access infrequent (few times/day),

and ground cover well established. Stream banks were 40% covered with grasses and shrubs. Forest canopy of aspen, black ash, white pine (*Pinus strobus*), birch, jack pine (*Pinus banksiana*) and balsam fir (*Abies balsamea*) covered 80% of the floodplain (trees from 30 to 70 cm dbh).

Reach III (150 m long, 4 cross sections, 3.58 km<sup>2</sup> watershed) was another half kilometer downstream. The flood plain and valley forest had 100% canopy closure by aspen, balsam fir, birch, black ash, white pine, and white spruce (*Picea glauca*). Herbaceous vegetation, hazel (*Alnus serrulata*), and balsam fir covered more than 60% of the stream banks. There was no cattle traffic and stream morphology was similar to natural reference streams with watersheds that were completely forested for at least 70 years (Riedel, et al, 2005 and Riedel, et al, 2002).

## METHODS

We analyzed stability for stream banks and beds using two methods:

1. Pfankuch's (1975) empirically based stream bank stability index (PSI);
2. Mechanistically based estimates.

**PSI Rating:** The PSI for each reach was determined according to the methods of Pfankuch (1975). Stream bank characteristics include bankfull channel capacity, bank rock content, channel obstructions, channel incision, and channel aggradation. Channel substrate was rated by rock angularity, rock brightness, degree of substrate armoring, substrate grain size distribution, occurrence of localized scour and deposition, and the existence and vigor of aquatic vegetation.

**Mechanistic Stream Stability Analysis:** We estimated mechanistic stability by comparing shear strength (resisting) and shear stress (driving) forces as the factor of safety (FSh):

$$FSh = S / H * (\gamma t) \quad (1)$$

where S = Shear strength (kPa), H = bank height (m),  $\gamma t$  = saturated weight of soil (kN/m<sup>3</sup>).

**Stream Banks:** We adapted the Mohr-Coulomb equation to include soil cohesive strength (adapted from Millar and Quick 1998) and the contribution of root tensile strength;

$$S = (N_s)cu + \sigma * \tan(\phi) + Cr \quad (2)$$

where

$N_s$  = saturated dimensionless stability (Huang, 1983) =  $3.83 + 0.052(90 - \theta) - 0.0001(90 - \theta)^2$  (Taylor, 1948);

$cu$  = Soil cohesive strength (kPa) =  $1.93 + 0.1444(PI)$  (lbs/ft<sup>2</sup>, Cousins, 1984),

PI = Plastic Index = plastic limit – liquefaction limit

$\sigma$  = Bank shear strength (kPa),

$\phi$  = Internal friction angle = angle of repose for stable banks,

Cr = root cohesion (kPa) (Gray and Megahan, 1981) =  $tr * (\cos(\theta) * \tan(\phi) + \sin(\theta))$  (Wu, 1976),

tr = root tensile strength per unit area (kPa m<sup>-2</sup>) and  $\theta$  = angle of root shear distortion.

Taylor's (1948) method to estimate  $N_s$  has been tested for stream bank applications (Millar and Quick, 1998). Undrained cohesive strength was estimated from PI, plasticity and liquefaction data (Mengel and Brown, 1979 and Lewis, 1978). Estimates of soil cohesion were consistent with published values (Huang, 1983 and Bjerrum and Simons, 1960). We computed shear

strength under saturated conditions, the  $\phi = 0$  approach (Huang, 1983), to remove the dependence on soil moisture content and pore water pressure ( $\sigma \tan(\phi) = \text{zero}$ ) (Spangler and Handy, 1982 and Peck and Lowe, 1960). Such conditions often preclude bank failure and occur following bankfull or larger flows (Alabyan and Chalov, 1998; Hickin, 1995; Leopold, et al., 1992; and Chang, 1979).

We estimated  $\tau_r$  by Wu's (1976) "theoretical model of a fiber-reinforced soil" which accounts for lateral and normal force components (Hammond, et al, 1992). This approach is valid when roots shear rather than slip and is applicable in cohesive soils (Abe and Ziemer, 1991 and Megahan, et al 1978). We obtained root mass and tensile strength data from a field study of 40+ sites in the Nemadji Watershed (Kaputaska and Davidson, 1979). Root distributions were limited to 0.5 m depth by the cohesive clay soils. Roots greater than 8 mm in diameter were not tested so we assigned these tensile strengths equivalent to those in the 8 mm size class.

**Stream Beds:** Bankfull average bed shear stress was estimated as;

$$\tau_{\text{bed}} = \gamma * R * S \quad (3)$$

where

$\gamma$  = Specific weight of water ( $\text{kg/m}^3$ ),

$R$  = Bankfull hydraulic radius (m) =  $A_x / W_p$ ,  $A_x$  = channel area ( $\text{m}^2$ ),  $W_p$  = wetted perimeter (m),

$S$  = Bankfull water surface slope (m/m),

Estimates were consistent with those from dimensionless values (ASCE, 1998; Ritter, et al., 1995; and Schumm, 1960). Shear stress distribution between the stream bed and banks was estimated with the empirical relationship of shear stress distribution in trapezoidal channels developed by Knight, et al (1984) and Flinham and Carling (1988):

$$SF_{\text{bank}} = 1.77 * (P_{\text{bed}} / P_{\text{bank}} + 1.5)^{-1.4} \quad (4)$$

where

$SF_{\text{bank}}$  = Proportion of total shear stress acting on channel banks;

$P_{\text{bed}}$ ,  $P_{\text{bank}}$  = Wetted perimeter of stream bed and banks, respectively (m).

Critical shear stress for the cohesive clay was estimated by two methods: 1. by sodium adsorption ratio (SAR), pore fluid salt concentrations, and conductivity (Arulanandan, et al, 1980). These data were obtained from the red clay study of Bahnick, et al, (1979); 2. Chow's unit tractive force relationships for cohesive soils (Chow, 1959). Estimated values were 3.61 Pa, and 4.79 Pa, respectively; we used the geometric mean, 4.16 Pa. Stream bank stability with respect to fluvial erosion was estimated as the factor of safety with respect to bank shear,  $FS_{\tau}$ .

$$FS_{\tau} = \tau_{\text{crit}} / \tau_{\text{bed}} \quad (5)$$

where

$\tau_{\text{crit}}$  = shield's critical shear stress for bank sediments (kPa),

$\tau_{\text{bed}}$  = mean bed fluvial shear stress (kPa).

## RESULTS

Width-depth ratios were largest and stability lowest on grazed reaches (Figure 3).

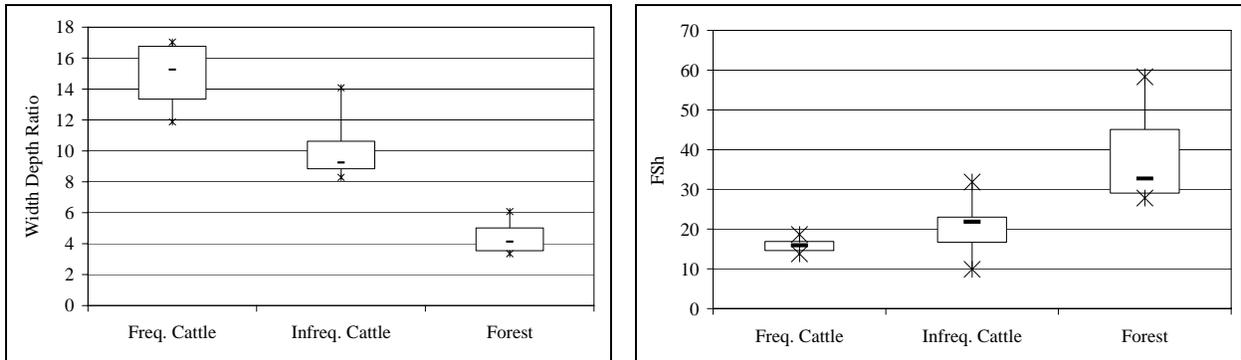


Figure 3 Stem and whisker plots of width depth ratios and mechanistic stream bank stability by reach (n=16/reach) (adapted from Riedel, et al, in review).

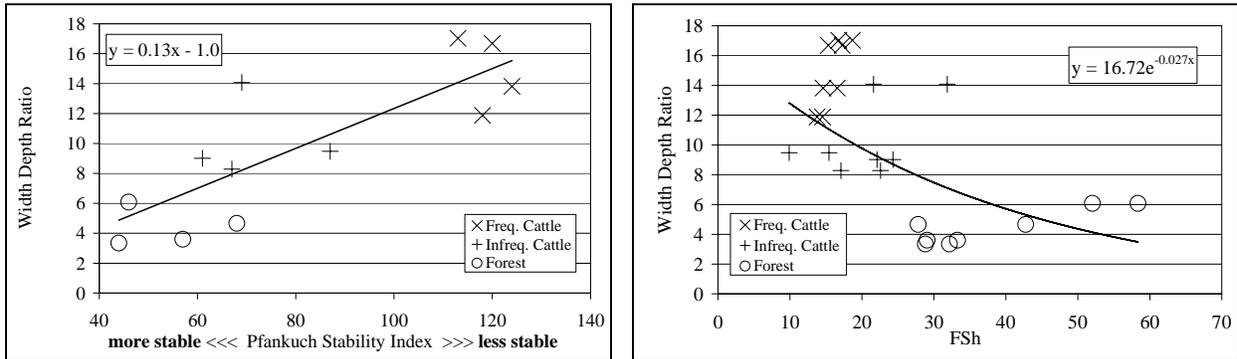


Figure 4 Scatter plots of width depth ratio by PSI and FSh. Note - PSI is inversely related to stability. Upstream / Downstream (dependence) arrangement of sites precludes regression and correlation analyses.

The width-depth ratio of streams increased with PSI (decreasing stability) in the study reaches (Figure 4). Width-depth increased as FSh decreased from forest to cattle sites (Figure 4). While stream banks were fluvially stable, stream beds were generally not stable (Figure 5). Bed stability was near the threshold at the frequent cattle site and declined slightly to the forest site.

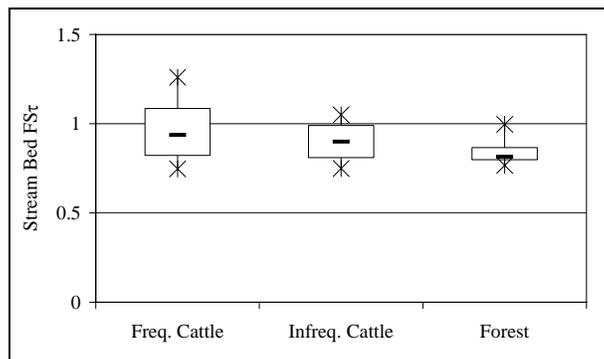


Figure 5 FSt of stream beds for each reach (n=16/reach)

PSI was inversely correlated to FSh (Figure 6) but independent of stream bed and bank  $FS\tau$ .

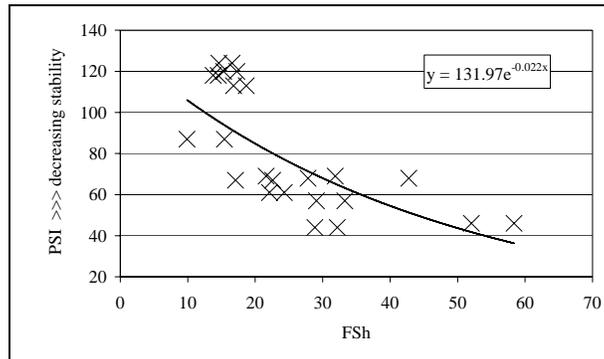


Figure 6 Pfankuch Stability Index (PSI) as related to calculated FSh There are 2 FSh values per reach. Upstream / Downstream (dependence) arrangement of sites precludes regression and correlation analyses.

## DISCUSSION

Mechanisms which alter the riparian land use condition have consistently been found to reduce the stability of the stream banks and induce erosion. Platts (1981) noted that stream banks had eroded, channels widened, and mean depth decreased in response to disturbance by sheep. Hupp and Simon (1986) attributed stream widening to reduced bank stability caused by vegetation removal and channelization. Millar and Quick (1998) found that riparian vegetation increased the critical bank shear stress of natural streams and allowed them to be narrower and have steeper bank angles. Burckhardt and Todd (1998) reported riparian forests stabilized the outside bank of meandering streams - unvegetated banks eroded three times faster. Numerous authors have found that the width-depth ratio of a stream increases in response to decreased bank stability. Schumm (1960) documented the tendency of normally narrow clay channel streams to widen in response to destabilization such as changes in stream bank vegetation. On Deer Creek, the width-depth ratio increased as bank stability decreased with cattle traffic. The width-depth ratios in the grazed riparian areas is controlled by frequency of cattle traffic because the cohesive banks have sufficient strength to resist gravitational failure. Conversely, the width-depth ratios of the forested stream reaches are dependent upon the factors of safety with respect to stream bank and streambed shear.

## CONCLUSIONS

Width-depth ratio of the study reaches were strongly related to both the Pfankuch (1976) and mechanistically estimated measures of streambank stability. Hoof shear from cattle traffic had the largest impact on stream bank stability because even with the loss of riparian vegetation, FSh was normally not exceeded. The  $FS\tau$  indicated that the stream bank materials were generally stable from fluvial erosion. It was the factor of safety for fluvial shear,  $FS\tau$ , of the stream bed materials that was commonly found to be exceeded. Instability of the stream banks only occurred with the removal of riparian vegetation and subsequent bank erosion caused by cattle traffic. The fluvial erosion thresholds for the stream bank materials were exceeded once materials were introduced into the streambed. The stream morphology and subsequent erosion

of stream bank and streambed materials were due to the destabilizing effects of cattle grazing and traffic on the stream banks. Consequently, stabilization of cohesive clay stream banks in this region may be accomplished by simply excluding cattle.

### ACKNOWLEDGEMENTS

Funding was provided by the US Forest Service, North Central Res. Sta., Grand Rapids, MN and the Univ. of MN, Dept. of Forest Resources, Ag. Exp. Sta., St. Paul, MN. The authors thank Jason Tidwell and Zhou XangQing for their field support. This project was conducted while Dr. Riedel worked at the Univ. of MN, Dept. of Forest Resources, St. Paul, MN and Dr. Verry served as Research Hydrologist, US Forest Service North Central Res. Sta., Grand Rapids, MN.

### REFERENCES

- Abe, K. and Ziemer, R.R. (1991). "Effect of tree roots on a shear zone: modeling reinforced shear stress," *Canadian Journal of Forest Research*, 21:1012–1019.
- Abernethy, B. and Rutherford, I.D. (2000). "The effect of riparian tree roots on the mass-stability of riverbanks," *Earth Surface Process and Landforms*, 25:921–93.
- Alabyan, A.M. and Chalov, R.S. (1998). "Types of river patterns and their natural controls," *Earth Surface Processes and Landforms*, 23:467–474.
- Arulanandan, K., Gillogley, E., and Tully, R. (1980). Development of a Quantitative Method to Predict Critical Shear Stress and Rate of Erosion of Natural Undisturbed Cohesive Soils, Report GL-80-5, USACOE Waterways Experiment Station, Vicksburg, MS.
- ASCE. (1998). "River Width Adjustment.I: Processes and Mechanisms," ASCE Task Comm. on Hydraulics, Bank Mechanics, and Modeling of River Width Adjustment, *Journal of Hydraulic Engineering*, 124(9):881–902.
- ASTM. (1997). "Standard classification of soils for engineering purposes, Annual Book of ASTM Standards, 4.08, Soil and Rock (I): D420–D4914.
- Bahnick, D.A., Markee, T.P. and Roubal, R.K. (1979). Chemical Effects of Red Clays on Western Lake Superior. USEPA #EPA-905/9-79-003, January.
- Basig, E.J. (1993). "Nemadji River Watershed - Carlton County 1:50,000 Map of Surficial Glacial Geology".
- Bjerrum, L. and Simons, N.E. (1960). "Comparison of shear strength characteristics of normally consolidated clays, Proc. The Research Conference on Shear Strength of Cohesive Soils. American Society of Civil Engineers, University of Colorado, Boulder, CO.
- Chang, H.H. (1979). "Minimum stream power and river channel patterns," *J. Hydrology*, 41:303–327.
- Charlton, F.G., Brown, P.M., and Benson, R.W. (1978). *The Hydraulic Geometry of Some Gravel Rivers in Britain*.
- Chow, V.T. (1959). *Open Channel Hydraulics*. McGraw-Hill, New York, NY.
- Cousins, F. (1984). Empirical relationships as reported by written communication to Simon and Hupp (1986). USDA Soil Conservation Service.
- Downs, P.W. and Thorne, C.R. (2000). "Rehabilitation of a lowland river: reconciling flood defense with habitat diversity and geomorphological sustainability," *Journal of Environmental Management*, 58:249–268.
- Dunaway, D., Swanson, S.R., Wendel, J., and Clary, W. (1994). "The effect of herbaceous plant communities and soil textures on particle erosion of alluvial stream banks," *Geomorphology*, 9:47–56.

- Flintham, T.P. and Caring, P.A. (1988). "The prediction of mean bed and wall boundary shear in uniform and compositely roughened channels," International Conference on River Regime. W.P. White ed. John Wiley & Sons, Inc. England. 367–287.
- Gray, D.H. and Megahan, W.F. (1981). Forest Vegetation Removal and Slope Stability in the Idaho Batholith, USDA Forest Service Intermountain Forest and Range Experiment Station Research Paper INT-271.
- Grissinger, E.H., Little, W.C., and Murphey, J.B. (1981). "Erodibility of stream bank materials of low cohesion," Transactions of the American Society of Agricultural Engineers, 24(3):624–630.
- Hammond, C., Hall, D., Miller, S., and Swetik, P. (1992). "Appendix B – root strength: a detailed literature review," Level I Stability Analysis (LISA) Documentation for Version 2.0. USDA Forest Service Intermountain Research Station Gen. Tech. Report INT-285.
- Hickin, E.J. (1995). "Hydraulic geometry and channel scour, Fraser River, British Columbia, Canada," River Geomorphology, Hickin, E.J. (ed), John Wiley & Sons.
- Hobbs, H.C. and J.E. Goebel. (1982). "Geologic Map of Minnesota: Quaternary Geology," Minnesota Geological Survey State Map Series Map S-1. Minnesota Geological Survey.
- Huang, H.Q. and Nanson, G.C. (1998). "The influence of bank strength on channel geometry: an integrated analysis of some observations," Earth Surface Process and Landforms, 23:865–876.
- Huang, Y.R. (1983). "Shear strength," Stability Analysis of Earth Slopes, Reinhold Publishing, NY, NY.
- Hupp, C.R. (1999). "Relations among riparian vegetation, channel incision processes and forms, and large woody debris," Incised River Channels, Processes, Forms, Engineering and Management, Darby, S.E. and Simon, A. (eds.), John Wiley & Sons.
- Hupp, C.R. (1992). "Riparian vegetation recovery patterns following stream channelization: a geomorphic perspective," Ecology, 73(4):1209–1226.
- Kaputska, L.A., and Davidson, D.W. (1979). "Role of plant roots in red clay erosion," Impact of Nonpoint Pollution Control on Western Lake Superior, Red Clay Project Final Report Part II. U. S. Environmental Protection Agency Report, EPA 905/9-76-002-B.
- Knight, D.W., Demetrious, J.D., and Hamed, M.E. (1984). "Boundary shear in smooth rectangular channels," Journal of Hydraulics, 110(4):405–422.
- Leopold, L.B., Wolman, M.G., and Miller, J.P. (1992). Fluvial Processes in Geomorphology.
- Lewis, R.R. (1978). "Soil Survey of Carlton County, Minnesota," USDA and MN Agricultural Experiment Station.
- MDNR. (1998). "Quaternary Geology of Michigan," Michigan Dept. of Natural Resources. Lansing, MI. 2nd ed.
- Megahan, W.F., Day, N.F., and Bliss, T.M. (1978). "Landslide occurrence in the western and central northern Rocky Mountain physiographic province in Idaho," 5th Annual North American Forest Soils Conference, Colorado State University, Fort Collins, CO. 1116 – 139.
- Mengel, J.T. and Brown, B.E. (1979). "Red clay slope stability factors," Impact of Nonpoint Pollution Control on Western Lake Superior, Red Clay Project Final Report Part II, U. S. Environmental Protection Agency Report, EPA 905/9-76-002-B.
- Millar, R.G. (2000). "Influence of bank vegetation on alluvial channel patterns," Water Resources Research, 36(4):1109–1118.
- Millar, R.G. and Quick, M.C. (1998). "Stable width and depth of gravel-bed rivers with cohesive banks," Journal Hydraulic Engineering, 124(10):1005–1013.

- Millar, R.G. and Quick, M.C. (1993). "Effect of bank stability on geometry of gravel rivers," *Journal Hydraulic Engineering*, 119(12):1343–1363.
- Osman, A.M. and Thorne, C.R. (1998). "Riverbank stability analysis. I: theory," *Journal of Hydraulic Engineering*, 114(2):134–150.
- Peck, R.B. and Lowe, J., III. (1960). "Moderator's report - session 4: shear strength of undisturbed cohesive soils," *The Research Conference on Shear Strength of Cohesive Soils*. American Society of Civil Engineers, June, 1960, University of Colorado, Boulder, CO.
- Pfankuch, D.J. (1975). *Stream Reach Inventory and Channel Stability Evaluation: A Watershed Management Procedure*, USFS general technical report R1-75-002, USDA Forest Service, Northern Region.
- Platts, W.S. (1981). *Effects of Sheep Grazing on a Riparian-Stream Environment*, USDA Forest Service Research Note INT307.
- Rhoads, B.L. and Welford, M.R. (1991). "Initiation of river meandering – instability and meander initiation," *Progress in Physical Geography*, 15(2)127–156.
- Riedel, M.S., Verry, E.S., and Brooks, K.N. In Review. *Riparian land use impacts on fluvial processes and the morphology of clay channel streams*. *J. Int. Assoc. of Great Lakes Research*.
- Riedel, M.S., Brooks, K.N. and Verry, E.S. (2005). "Impacts of land use conversion on bankfull discharge and mass wasting," *Journal of Environmental Management*, 76(2005)326–337.
- Riedel, M.S., Verry, E.S. and Brooks, K.N. (2002). "Land use impacts on fluvial processes in the Nemadji River watershed." *Hydrologic Science and Technology*, 18(1-4):197-205.
- Ritter, D.F., Kochel, R.C., and Miller, J.R. (1995). "Fluvial processes," in *Process Geomorphology*, 3rd edition, chpt. 6, Wm. C. Brown Publishers, Dubuque, IA.
- Schumm, S.A. (1960). *The Shape of Alluvial Rivers in Relation to Sediment Type*, USGS Prof. Paper 352 – B.
- Shields, F.D., Knight, S.S., and Cooper, C.M. (2000). "Cyclic perturbation of lowland river channels and ecological response," *Regulated Rivers: Reservoir Management*, 16:307–325.
- Simon, A. and Hupp, C.R. (1986). *Channel Widening Characteristics and Bank Slope Development Along a Reach of Cane Creek, West Tennessee*, USGS Water Supply Paper 2290.
- Smith, C.H. (1998). "Modeling high sinuosity meanders in a small flume," *Geomorphology*, 25:19–30.
- Spangler, M.G. and Handy, R.L. (1982). *Soil Engineering*. 4th ed. Harper and Row Publishing, Inc., NY.
- Taylor, D.W. (1948). *Fundamentals of Soil Mechanics*, John Wiley and Sons, Inc., NY, NY.
- Trimble, S.W. (1994). "Erosional effects of cattle on stream banks in Tennessee, U.S.A.," *Earth Surface Processes and Landforms*, 19:451–464.
- UMN. (1997). "Geomorphology of Minnesota," *Univ. of MN-Duluth, MN Geo. Surv., and MN Dept. of Nat. Res.*
- USDA. (1994). *State Soil Geographic (STATSGO) data for Wisconsin*. USDA, Fort Worth, TX.
- Wu, T.U. (1976). *Investigation of Landslides on Prince of Wales Island, Alaska*, Geotechnical Report No. 5, Dept. of Civil Engineering, Ohio State University, Columbus, OH.
- Ziemer, R.R. (1978). "An apparatus to measure the crosscut shearing strength of roots," *Canadian Journal of Forest Research*, 8:–144.